



DEALER SERVICE HISTORY

Report generated October 26, 2026

2024 BMW iX xDrive50

VIN WB523CF00RCXXXXXX SERIES / MODEL I20 / 23CF FIRST DEALER RECORD August 2023

LAST ODOMETER	DEALER VISITS	DEALERS	AVG. USAGE	LAST SERVICE
75,542 miles · Apr 29, 2026	8 6 repair orders	1 servicing locations	27,900 miles per year	Apr 2026 Princeton BMW , Hamilton

Report highlights

✓ **Odometer consistent**
13 dealer readings rise steadily with no rollback detected.

✓ **Recall / campaign performed**
Jul 17, 2025: Program control units campaign.

i **Warranty / maintenance-plan coverage**
4 of 8 visits included covered work.

Current maintenance status


Read April 29, 2026 at 75,511 mi · Princeton BMW , Hamilton

Vehicle check Due Jul 2027 OK	Brake fluid Due Jul 2027 OK
Front brakes No interval reported OK	Rear brakes No interval reported OK
Cabin filter Due Jul 2027 OK	Vehicle check additional scope Due Jul 2027 OK

Vehicle memory at this reading: 1 active Check Control message · 44 stored fault-memory entries across control units. Stored entries are historical logs and do not by themselves indicate a current fault.

Mileage history

Odometer readings recorded by BMW dealers, in miles.

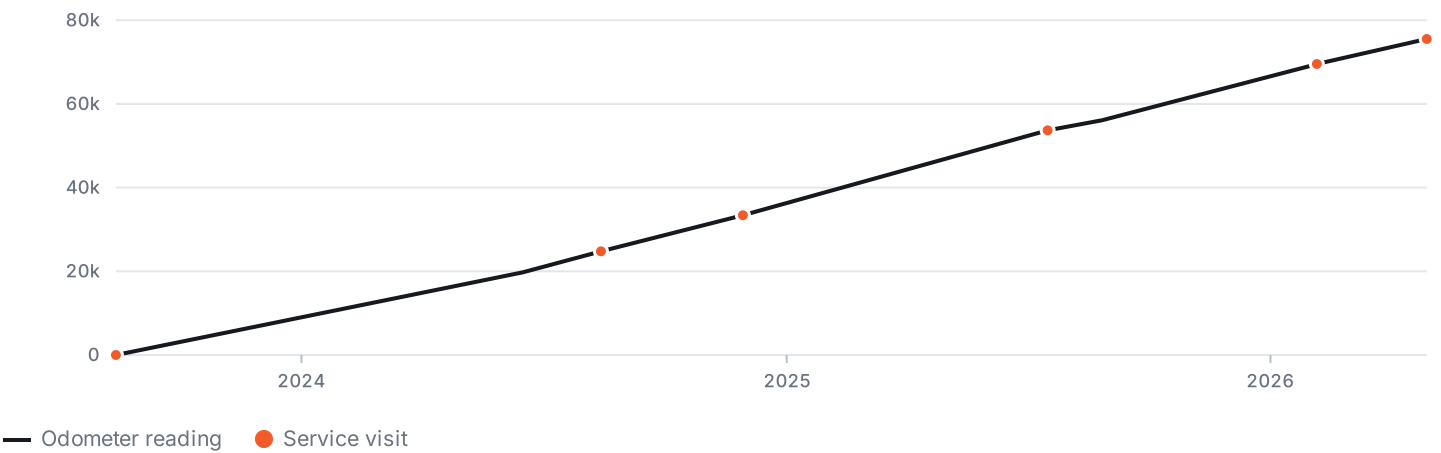

Service timeline

Apr 29 2026	Princeton BMW , Hamilton Apr 29, 2026 · 75,542 mi (121,573 km) · RO 808796C	Customer pay
- Owner states right rear tire is losing air -advise Mount and balance one run flat tire Michelin primacy tour as acoustic str xl 85455A66E31 Wheel weight - Perform complimentary vehicle health check		
Feb 5 2026	Princeton BMW , Hamilton Feb 5, 2026 – Feb 9 · 69,525 mi (111,890 km) · RO 804728W	Warranty
- Owner states that there is a warning lamp on and the vehicle sounds like a sewing machine Verifying customer concern and diagnosing cause · Replacing electric A/C compressor · Extract, evacuate and fill air conditioning system Electric a/c compressor 64525B31E59 Gasket ring 64539284019 Gasket ring 64539284018 - Perform complimentary vehicle health check - As a valued customer of princeton BMW. We are performing the above repair as a one time gesture of good will. Also: Loaner vehicle		
Aug 27 2025	Princeton BMW , Hamilton Aug 27, 2025 · 56,115 mi (90,308 km)	Vehicle data read
Vehicle data read at the dealer (odometer and maintenance status). No repair order was filed for this visit.		

Jul 17
2025

Princeton BMW , Hamilton

Jul 17, 2025 – Jul 21 · 53,689 mi (86,404 km) · RO 793945W

Warranty

Customer pay

DUE AT ARRIVAL

Vehicle check

Brake fluid

Cabin filter

- Customer states the front wipers are streaking.

Replace left and right wiper blade

Set of wiper blades 61615A0B571

- Customer states the rear wiper is streaking.

Replacing the wiper blade for the rear wiper

Wiper blade 61627954693

- Service - perform standard scope/checklist

Standard scope of service

- Brake fluid exchange service

Brake fluid service

Brake fluid 81220142156

- Microfilter service (consider further additional job if appropriate)

Service - microfilter

Nanoparticle filter 64115A30A93

- Program control units campaign

Programming control units wp#3

- Service, vehicle check

Vehicle check service

- tire wear uneven perform 4 wheel graphing alignment with tire replacement

- tires worn low in tread mount and balance 4 tires

4× unknown part: PRIMACY TOUR A/S STR XL:369041 4× Wheel weight

- By providing your telephone number to us, you authorize us to call or text you at the contact information you have provided, including through automated means. Such communications may include updates concerning your vehicle, appointment reminders and future communications regarding recommended maintenance. Terms Apply: <https://www.princetonbmw.com/mobile-alert-terms-and-conditions/>

- Perform complimentary vehicle health check

Nov 29
2024

Princeton BMW , Hamilton

Nov 29, 2024 – Dec 6 · 33,404 mi (53,758 km) · RO 780840C

Customer pay

- Client states that r/r tire has a nail. Purchased 4 tires under RO# 774695

Mount and balance one run flat tire

Michelin primacy tour as acoustic str xl 85455A66E31 Wheel weight

- Perform complimentary vehicle health check

- Fluid top off and set tire pressure

Aug 14
2024

Princeton BMW , Hamilton

Warranty

Customer pay

Aug 14, 2024 – Aug 27 · 24,772 mi (39,867 km) · RO 774695W

- Owner states that the steering warning is on -advise

Verifying customer concern and diagnosing cause · Removing and installing/replacing front left or right wheel arch cover · Replace electrical steering box (EPS) · Commissioning of electromechanical steering gear (EPS) / initialization · Kinematics Diagnosis System wheel alignment with ride height measurement without loading the vehicle · Adjusting toe-in on front axle

Hex bolt with washer 07119905400

Torx bolt 32306778609

4× Torx screw with collar 31306865951

2× Combination nut 33306787062

4× Hex nut wiht flange 37106789678

4× Hex bolt 07146898283

14× Multi-purpose bolt 31116899302

Steering gear, electric 32105B357F4

3× Expanding rivet 51161881149

- Owner states that the t.p.m. Warning on for the right rear -advise

- Program complete vehicle

Program control units (quality measure)

- Fluid top off and set tire pressure

- Puncture in passenger rear tire rear tires worn and fronts are getting low

4× Michelin primacy tour as acoustic str xl 85455A66E31

4× Wheel weight

- Recommend 4 wheel alignment

- Perform complimentary vehicle health check

- Michael rose

Also: Loaner vehicle

Jun 16
2024

Princeton BMW , Hamilton

Vehicle data read

Jun 16, 2024 · 19,744 mi (31,775 km)

Vehicle data read at the dealer (odometer and maintenance status). No repair order was filed for this visit.

Aug 14
2023

Princeton BMW , Hamilton

Warranty

Aug 14, 2023 · 8 mi (13 km) · RO 754748W

- BMW QC1 - Spot Delivery

- Install wheel locks

- New car detail

- Install stargard

Gps tracker

Maintenance status history

Condition Based Service values read from the vehicle key at each dealer visit. Numbers are miles remaining until service (negative = overdue); dates show the next time-based deadline. Identical consecutive readings are combined (×n).

DATE	ODOMETER	VEHICLE CHECK	BRAKE FLUID	FRONT BRAKES	REAR BRAKES	CABIN FILTER	VEHICLE CHECK ADDITIONAL SCOPE
Apr 29, 2026 ×3	75,511	Jul '27	Jul '27			Jul '27	Jul '27
Jul 17, 2025	53,667	Aug '25	Aug '25			Aug '25	
Nov 29, 2024 ×3	33,390	Aug '25	Aug '25			Aug '25	

OK

Due soon

Overdue

While every reasonable effort is made to ensure the accuracy of this data, we are not responsible for any errors or omissions contained in this report. Please verify any information in question with BMW Customer Relations or your local BMW center. All trademarks, trade names, service marks, product names, option names and logos are the property of their respective owners.

© 2026 VIN Analytics, LLC. All rights reserved.

