DEALER SERVICE HISTORY

Report generated November 2, 2026

2015 MINI Cooper S

VIN WMWXU3C59F2XXXXXX SERIES / MODEL F55 / XU43 FIRST DEALER RECORD June 2017

LAST ODOMETER	DEALER VISITS	DEALERS	AVG. USAGE	LAST SERVICE
17,677	5	3	2,200	Feb 2024
miles · Feb 19, 2024	4 repair orders	servicing locations	miles per year	BMW of San Antonio/MINI of San Anto , San Antonio

Report highlights

Odometer consistent
8 dealer readings rise steadily with no rollback detected.

Oil service timing
Engine oil was flagged overdue at 2 of 4 key readings when the car arrived at the dealer.

Current maintenance status


Read February 19, 2024 at 17,654 mi · BMW of San Antonio/MINI of San Anto , San Antonio

Engine oil Due Mar 2024 · 9,300 mi left	OK	**Vehicle check** Was due Mar 2022 · 9,300 mi left	Overdue
Brake fluid Was due Jun 2021	Overdue	**Cabin filter** No interval reported	OK
Air filter No interval reported	OK	**Spark plugs** No interval reported	OK

Vehicle memory at this reading: 0 active Check Control messages · 23 stored fault-memory entries across control units. Stored entries are historical logs and do not by themselves indicate a current fault.

Mileage history

Odometer readings recorded by MINI dealers, in miles.

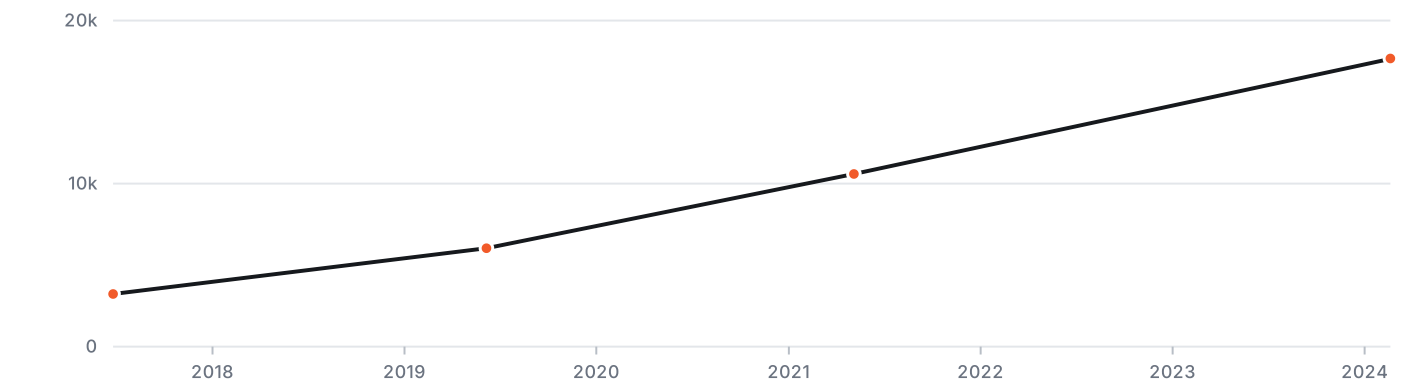

Service timeline

Feb 19
2024

BMW of San Antonio/MINI of San Anto , San Antonio

Customer pay

Feb 19, 2024 · 17,677 mi (28,449 km) · RO 1025842C

DUE AT ARRIVAL Brake fluid Vehicle check

- Replace batteryand registerto vehicle (MINI) inc
  EP Battery 80AH `61215A40E31`
- Customer states car sometimes has a slow crank or has to be jumped

Also: Multi-point inspection · Car wash

May 5
2021

BMW of San Antonio/MINI of San Anto , San Antonio

Customer pay

May 5, 2021 · 10,593 mi (17,048 km) · RO 032382C

DUE AT ARRIVAL Vehicle check

No work description recorded for this visit.

Jun 6
2019

MINI of Austin

Customer pay

Jun 6, 2019 – Jun 7 · 6,035 mi (9,713 km) · RO 831371C

DUE AT ARRIVAL Brake fluid Engine oil Vehicle check Cabin filter

- Customer requests oil service
  Oil service
  Set oil-filter element `11428570590` BMW Group LL-01 FE 0W-30 `83212449994`
- Brake flush
  Brake fluid `81220146735`

- Customer requests replace AC microfilter(s)
  Microfilter
  Set, microfilter/activ. charcoal filter `64116823725`
- Client states right rear tire low. Pre auth up to $280.00
  M&B 1 tire
  Tape weight 50g | Pirelli cinturato P7 runflat (MINI) XL `36112289170`
- Service advisor has notified client
  Notified client
- Report card needed for completion

Also: Car wash

Jun 26
2017

MINI of Austin

Customer pay

Jun 26, 2017 · 3,232 mi (5,202 km) · RO 814418C

DUE AT ARRIVAL Engine oil Vehicle check

No work description recorded for this visit.

Also: Car wash

Jun 26
2017

BMW of Austin , Austin

Vehicle data read

Jun 26, 2017 · 3,231 mi (5,200 km)

DUE AT ARRIVAL Engine oil Vehicle check

Vehicle data read at the dealer (odometer and maintenance status). No repair order was filed for this visit.

Maintenance status history

Condition Based Service values read from the vehicle key at each dealer visit. Numbers are miles remaining until service (negative = overdue); dates show the next time-based deadline. Identical consecutive readings are combined (×n).

DATE	ODOMETER	ENGINE OIL	VEHICLE CHECK	BRAKE FLUID	CABIN FILTER	AIR FILTER	SPARK PLUGS
Feb 19, 2024	17,654	9,300	9,300	Jun '21			
May 5, 2021	10,589	10,600	21,100	Jun '21	10,600	10,600	
Jun 6, 2019	6,033	6,200	31,100	Nov '17	6,200		
Jun 26, 2017	3,231	5,000	29,200	Nov '17			

OK Due soon Overdue

While every reasonable effort is made to ensure the accuracy of this data, we are not responsible for any errors or omissions contained in this report. Please verify any information in question with MINI Customer Relations or your local MINI dealer. All trademarks, trade names, service marks, product names, option names and logos are the property of their respective owners.

© 2026 VIN Analytics, LLC. All rights reserved.

VINANALYTICS